

NEW ZEALAND TEMPORARY AND PRELIMINARY NOTICES IN FORCE

(NZ NTM Edition No. 24 dated 25 November 2022)

NZ Notice	T/P	Charts Affected	Locality and Subject
66/21	T	NU 131	South Pacific Ocean, NIUE - Alofi Anchorage: Aid to Navigation
20/22	T	NZ 661	South Island - East Coast, Approaches to Otago Harbour: Subsurface Scientific Instruments, Lit Buoys
23/22	T	NZ 5224	North Island - East Coast, Great Barrier Island (Aotea Island): No anchoring buoys
24/22	P	TO 301	Tonga - Vava'u Group, Neiafu Harbour: Buoys
38/22	T	NZ 6825	Stewart Island/Rakiura, Paterson Inlet/Whaka a Te Wera - Ulva Island: Wave buoy
43/22	P	NZ 6142	South Island - North Coast, Port Nelson: Dredged Areas
51/22	T	NZ 5612	North Island - East Coast, Napier: Wave buoy
53/22	T	NZ 865, WS 312	Samoa - Upolu Island, Approaches to Apia: Samoa Entry Restrictions and Buoys
56/22	P	NZ 632, NZ 6321, NZ 6324	South Island - East Coast, Banks Peninsula: Rocks
57/22	T	NZ 7142	South Island - West Coast, Greymouth Harbour: Depths
58/22	P	NZ 82 (T 82)	South Pacific Ocean, Tonga - West of Vava'u Group - Home Reef: Volcanic Activity
61/22	T	NZ 6612	South Island - East Coast, Otago Harbour - Te Rauone Beach: Exclusion zone
62/22	T	NZ 53, NZ 532, NZ 5324, NZ 5325	North Island - East Coast, Tāmaki Strait - Browns Island (Motukorea): Aid to Navigation

An asterisk * in a temporary or preliminary notice indicates a new or revised entry.

NZ 66(T)/21 SOUTH PACIFIC OCEAN - NIUE - Alofi Anchorage. Aid to Navigation

1. The following light is temporarily unlit until further notice:

<i>Name</i>	<i>Description</i>	<i>Position</i>
Alofi Rear	F.R.24m5M	19°03'.210S 169°55'.189W

2. Mariners are advised to exercise caution when navigating in the area.

Chart temporarily affected: NU 131

BA Light List (Volume K): 4656.1

Ministry of Infrastructure -Niue
HITS 131/4

NZ 20(T)/22 NEW ZEALAND - South Island - East Coast - Approaches to Otago Harbour. Subsurface Scientific Instruments, Lit Buoys

1. Former notice - NZ 56(T)/21 is cancelled.
- * 2. Subsurface scientific instruments, marked with lit yellow buoys Fl(5)Y.20s have been deployed at the following locations, until further notice:
 - a.) 45°39'.78S., 170°46'.55E.
 - b.) 45°43'.75S., 170°37'.18E.

3. Mariners are advised to exercise caution when navigating in the area.

Chart temporarily affected: NZ 661

University of Otago
HITS 661/14

NZ 23(T)/22 NEW ZEALAND - North Island - East Coast - Great Barrier Island (Aotea Island). No anchoring buoys

1. Lit yellow buoys Fl(4)Y.12s have been temporarily deployed at the following locations, until further notice:
 - a.) 36°15'.07S., 175°23'.50E.
 - b.) 36°19'.11S., 175°29'.27E.
2. There should be no anchoring within 50 metres of the buoys.
3. Mariners are advised to exercise caution when navigating in the area.

Chart temporarily affected: NZ 5224

NIWA
HITS 5224/6

NZ 24(P)/22 TONGA - Vava'u Group - Neiafu Harbour. Buoys

1. Former notice - NZ 29(P)/21 is cancelled in conjunction with the permanent withdrawal of chart NZ 8225.
2. Buoys in the vicinity of 18° 40'.360S., 173° 59'.300W. mark charted wreck and attached equipment.
3. Charting action will take place in due course.
4. Mariners are advised to exercise caution when navigating in the area.

Chart affected: TO 301

Ministry of Infrastructure Tonga - Marine and Ports Division, Vava'u Volunteer Maritime Response Association
HITS 301/1 and HITS 8225/14

NZ 38(T)/22 NEW ZEALAND - Stewart Island/Rakiura - Paterson Inlet/Whaka a Te Wera - Ulva Island. Wave buoy

1. A yellow lit wave buoy, *Fl.Y.2.5s* has been deployed at 46°55'.46S, 168°07'.74E until further notice.
2. Mariners are advised to exercise caution when navigating in the area.

Chart temporarily affected: NZ 6825

Offshore and Coastal Engineering Limited
HITS 6825/9

NZ 43(P)/22 NEW ZEALAND - South Island - North Coast - Port Nelson. Dredged Areas

1. A recent survey indicates shallower depths than charted in the following dredged areas:
 - a) Outer channel 7.9m (charted 8.1m)
 - b) Inner channel 7.5m (charted 7.6m)
 - c) Brunt Quay 9.6m (charted 10.0m)
 - d) Kingsford Quay 9.3m (charted 9.5m)
2. Depths significantly shallower than the charted dredged values are to be expected. Mariners are to contact the Harbourmaster for information on the latest depths.
3. Dredging is planned for September 2022 to maintain original depths.
4. Mariners are advised to exercise caution when navigating in the area.
5. Charting action will take place in due course.

Chart affected: NZ 6142

Port Nelson Ltd
HITS 6142/290

NZ 51(T)/22 NEW ZEALAND - North Island - East Coast - Napier. Wave buoy

1. A yellow wave buoy, *Fl.W.3s* has been deployed at 39°28'.22S., 176°53'.67E., until further notice.
2. Mariners are advised to exercise caution when navigating in the area.

Chart temporarily affected: NZ 5612

MetOcean Solutions
HITS 5612/90

NZ 53(T)/22 SAMOA - Upolu Island - Approaches to Apia. Samoa Entry Restrictions and Buoys

1. Former notice - NZ 25(T)/22 and NZ 26(T)/22 are cancelled.
- * 2. Data collection wave buoys have been installed in the following positions until further notice:
 - a. 13°47'.43S, 171°45'.28W.
 - b. 13°48'.72S, 171°45'.23W.
- * 3. Mariners are advised to exercise caution when navigating in the area.

Charts temporarily affected: NZ 865, WS 312

Ministry of Works, Transport & Infrastructure - Samoa
HITS 865/55, HITS 312/23 and HITS 312/24

NZ 56(P)/22 NEW ZEALAND - South Island - East Coast - Banks Peninsula. Rocks

1. A recent survey (2021) in the vicinity of Banks Peninsula indicates changes to charted features and depths. The most significant changes are as follows:

	<i>Position</i>	<i>Depth</i>	<i>Feature</i>
(a)	43°36'.338S., 172°51'.824E.	8.3	Underwater Rock
(b)	43°36'.380S., 172°51'.772E.	4	Underwater Rock
(c)	43°36'.939S., 172°54'.046E.	9.3	Underwater Rock
(d)	43°41'.865S., 173°06'.642E.	3.4	Underwater Rock
(e)	43°44'.014S., 173°08'.036E.	7.2	Underwater Rock
(f)	43°46'.685S., 173°07'.968E.	8	Underwater Rock
(g)	43°50'.052S., 173°06'.248E.	-1.6	Underwater Rock
(h)	43°51'.319S., 172°45'.484E.	1.6	Underwater Rock
(i)	43°52'.045S., 172°47'.529E.	1	Underwater Rock
(j)	43°52'.260S., 172°46'.838E.	3	Underwater Rock
(k)	43°52'.433S., 173°02'.108E.	0.9	Underwater Rock
(l)	43°52'.856S., 172°49'.200E.	4.5	Underwater Rock
(m)	43°53'.474S., 172°50'.047E.	0.4	Underwater Rock
(n)	43°53'.803S., 172°53'.963E.	7.2	Underwater Rock

2. Mariners are advised to exercise caution when navigating in the area.
3. Charting action will take place in due course.

Charts affected: NZ 632, NZ 6321, NZ 6324

Discovery Marine Ltd.
HITS 632/23

NZ 57(T)/22 NEW ZEALAND - South Island - West Coast - Greymouth Harbour. Depths

1. Former notice - NZ 31(T)/22 is cancelled.
2. A recent survey (06 September 2022) indicates the following least depths below CD on the bar at the Grey River/Māwheranui entrance:

<i>Position</i>	<i>Lead</i>	<i>Depth</i>
42° 26'.340S., 171° 11'.424E.	North Lead	3.7m
42° 26'.354S., 171° 11'.416E.	Main Lead	4.2m
42° 26'.297S., 171° 11'.288E.	South Lead	5.1m

3. Mariners should be aware that depths in Greymouth Harbour entrance are constantly changing and should contact the Port of Greymouth for the latest conditions on (03) 768 5666 or Greymouth Harbour Radio Ch14.

Chart temporarily affected: NZ 7142

Port of Greymouth
HITS 7142/97

NZ 58(P)/22 SOUTH PACIFIC OCEAN - Tonga - West of Vava'u Group - Home Reef. Volcanic Activity

1. Underwater volcanic activity has been reported in the vicinity of 18°59'.55S. 174°46'.44W.
2. Home Reef has re-emerged above sea level.
3. Mariners are advised to maintain a minimum distance of 2NM from Home Reef and to exercise caution when navigating in the area.
4. Charting action will take place in due course.

Chart affected: NZ 82 (T 82)

Rescue Coordination Centre New Zealand
HITS 82/1056

NZ 61(T)/22 NEW ZEALAND - South Island - East Coast - Otago Harbour - Te Rauone Beach. Exclusion zone

1. A temporary exclusion zone has been established around the pipe replenishing sand to Te Rauone Beach. The coordinates of the area are as follows:
 - a. 45°47'.44S., 170°43'.31E.
 - b. 45°47'.53S., 170°43'.58E. (shoreline)
 - c. 45°47'.75S., 170°43'.40E. (shoreline)
 - d. 45°47'.61S., 170°43'.11E.
2. Two yellow lit piles are temporarily deployed, centred on: 45°47'.50S., 170°43'.29E.
3. Mariners are advised to avoid navigating in the area and to listen on VHF Ch14 for radio warnings. Contact Port Otago Harbour Control at (03) 472 9882 for more information.

Chart temporarily affected: NZ 6612

HITS 6612/328
Port Otago Ltd.

NZ 62(T)/22 NEW ZEALAND - North Island - East Coast - Tāmaki Strait - Browns Island (Motukorea). Aid to Navigation

1. The following light has been reported as temporarily unlit until further notice:

<i>Name</i>	<i>Description</i>	<i>Position</i>
Browns Island (Motukorea)	Fl.WR.4s10m6/4M	36°49'.44S 174°53'.93E

2. Mariners are advised to exercise caution when navigating in the area.

Charts temporarily affected: NZ 53, NZ 532, NZ 5324, NZ 5325

NZ Light List: 3847

Auckland Transport
HITS 5325/75