

NEW ZEALAND NOTICES TO MARINERS

Notices

NZ 99 – 109

© Crown Copyright 2009. All rights Reserved. Permission is not required to make analogue copies of these Notices but such copies are not to be sold.

CONTENTS

- I [Explanatory Notes.](#)
- II [New Zealand Notices to Mariners.](#)
- III [Corrections to New Zealand Light List.](#)
- IV [Corrections to Sailing Directions and New Zealand Publications.](#)
- V [Navigational Warnings. \(NAVAREA XIV\)](#)
- VI [Corrections to Admiralty List of Radio Signals.](#)

New Zealand Notices to Mariners are the authority for correcting New Zealand charts within the New Zealand area of charting responsibility as shown in Notice No. 1.

Mariners are requested to immediately inform Land Information New Zealand, Private Box 5501 Wellington 6145, New Zealand Phone : 0800 665 463 or (04) 460-0110 Fax: (04) 460-0161 or e-mail: info@linz.govt.nz, of the discovery of new or suspected dangers to navigation, or shortcomings in charts and publications.

Changes or defects in aids to navigation should be reported to the Rescue Coordination Centre New Zealand (RCCNZ) via the nearest New Zealand Coastal Maritime Radio Station Phone : (04) 577-8030 Fax : (04) 577-8038 or (04) 577-8041 e-mail: rccnz@maritimenz.govt.nz.

Copies of these Notices can be obtained from Land Information New Zealand, Maritime New Zealand, Principal Chart Agents at the major ports of New Zealand and the Internet: <http://www.linz.govt.nz>

EXPLANATORY NOTES

Charts. The notices in Section II give instructions for the correction of charts. Geographical positions refer to the largest scale chart unless otherwise stated. They are normally given in degrees, minutes and decimals of a minute, but may occasionally quote seconds for convenience when plotting from the graduation of some older-style charts. Bearings are true reckoned clockwise from 000° to 359°; those relating to lights are given as seen by an observer from seaward. Symbols referred are those shown in publication Chart 5011 (*INT 1*) Symbols and Abbreviations used on Admiralty Charts, published by the United Kingdom Hydrographic Office.

Alterations to depth contours, deletion of depths to make way for new detail, etc. are not mentioned unless they have some navigational significance.

Blocks or notes accompanying notices in Section II are placed after Section VI.

Temporary and Preliminary Notices. These are indicated by (T) or (P) after the notice number. A list of (T) and (P) Notices in force is published in the fortnightly Editions of Notices to Mariners. Charts are not corrected for them before issue; they should be corrected in pencil on receipt.

Light Lists. The detailed correction to the Light List is given in Section III and may not be published in the same edition as the chart correcting notice. The entire entry for each light is printed, and an asterisk (*) is shown under the column which contains an amendment. In the case of a new light, an asterisk (*) appears under all the columns. New and extensively altered entries are intended to be pasted in. It is recommended that a manuscript entry be made for all shorter corrections.

It is emphasized that the List of Lights is the authority for lights and that many alterations, especially those of a temporary but operational nature, may only be promulgated as corrections to the List of Lights.

Radio Signals. When radio signals are affected by a notice the Admiralty List of Radio Signals reference number is quoted. The detailed correction to the List of Radio Signals is given in Section VI and may be published in a later edition than the chart correcting notice.

Sailing Directions. Corrections to Sailing Directions are given in Section IV. It is recommended that such corrections be kept together in a file with the latest list of those in force on top. The file can then be consulted when using the parent book to see if any notices affecting the area under consideration are extant.

Corrections should not be pasted into the parent book or Supplement as corrections may be issued between closing date and issue of a new Supplement. These will be embodied in the text of the following Supplement. A summary of corrections in force will be issued in Section IV of the Fortnightly Edition at monthly intervals.

New Zealand Publications. Corrections to New Zealand Publications are given in Section IV.

Correction of Charts and Publications by the User. New Zealand Notices to Mariners contain important information and should be used to keep the specified charts and books up to date.

THE USE OF CHARTS AND ASSOCIATED PUBLICATIONS

Reliance on Charts and Associated Publications. While every effort is made to ensure the accuracy of the information on New Zealand charts and other publications, it should be appreciated that it may not always be complete and up to date. The mariner must be the final judge of the reliance to be placed on the information given, bearing in mind their particular circumstances, local pilotage guidance and the judicious use of available navigational aids.

Charts. Charts should be used with prudence: there are areas where the source data are old, incomplete or of poor quality. The mariner should use the largest scale appropriate for his particular purpose; apart from being the most detailed, the larger scales are usually corrected first. When extensive new information (such as a new hydrographic survey) is received, some months may elapse before it can be fully incorporated in published charts. On small scale charts of ocean areas where hydrographic information is, in many cases, still sparse, charted shoals may be in error as regards position, least depth and extent. Undiscovered dangers may exist, particularly away from well-established routes.

Further guidance. The Mariner's Handbook (NP 100) gives a fuller explanation of the limitations of charts. All users should study it in their own interest.

II

NUMERICAL INDEX OF CHARTS AFFECTED (NZ NTM Edition No.9 dated 1 May 2009)

NZ Chart No.	NZ Notices	INT Chart No.	Notices
NZ 23	NZ 105(T)		
NZ 25	NZ 105(T)		
NZ 62	NZ 105(T)		
NZ 63	NZ 105(T)		
NZ 614	NZ 101, 109(T)		
NZ 632	NZ 106(T)		
NZ 845	NZ 101		
NZ 885	NZ 101		
NZ 5113	NZ 101		
NZ 5215	NZ 101		
NZ 5612	NZ 104(T)		
NZ 6144	NZ 101		
NZ 6321	NZ 106(T)		
NZ 6324	NZ 101		
NZ 6422	NZ 101		
NZ 6612	NZ 107(P)		
NZ 7142	NZ 108(T)		
NZ 8275 (T 8275)	NZ 102		
ENC Cell	Notices		

NEW ZEALAND TEMPORARY AND PRELIMINARY NOTICES IN FORCE

(NZ NTM Edition No.9 dated 1 May 2009)

NZ Notice	T/P	Charts Affected		Locality and Subject
		NZ	INT	
133/01	T	6612		Otago Hr.: Shoaling
180/03	T	6154		Picton Hr.: Shoal Depths.
129/04	T	52, 53, 522, 5227		Hauraki Gulf: Dredging Operations
194/04	P	46, 48, 61, 463, 614, 6151, 6152, 6153, 6154		Marlborough Sounds: Use of Automated Navigation Systems
110/05	T	8248		Tonga: Light Unlit
161/05	P	4633, 4634		Wellington Hr.: Navigation Safety Bylaw
173/05	T	53, 54, 531, 534, 5318		Whitianga Hr.: Sandbar
36/06	T	5215		Whangarei Hr.: Shoaling
176/06	T	23, 26, 56, 14060, 14600	60, 600, 640	N. Island, E. Coast: Scientific Instruments
177/06	T			Indian Ocean: Operation 'Enduring Freedom'
205/06	T	532, 5324		Tamaki Strait: Motuihe Is.: E. Cardinal Lt Beacon
213/06	P	6153, 6154		Picton Hr.: Lights
244/06	T	23, 25, 63, 64	640, 648	Lyttelton Hr.: Waverider Buoy
37/07	T	53, 532, 533, 5327		Firth of Thames: Moorings, Research Instruments
56/07	T	73		Jackson Bay: Dolphin Monitoring Sensors
63/07	T	4633		Wellington Hr.: Race Marker Buoys
80/07	T	845, 14630, 14631	630, 631	Niue Is.: Navigational Aids, Lights
219/07	P	54, 542		Bay of Plenty, Opotiki: Fish Haven
20/08	T	54, 542		Bay of Plenty: Research Instruments
35/08	T	614		Motueka River: Current Meter
91/08	P	4424		W. Coast, Taharoa Hr.: Hr. Limits
98/08	T	7142		Greymouth Hr.: Depths
131/08	T	68, 69, 681		Foveaux Strait, Ruapuke Is.: Seabed Obstruction
132/08	T	14051, 14052, 14060, 14061, 14604, 14605, 14606, 14607, 14629	51, 52, 60, 61, 604, 605, 606, 607, 629	North, South Pacific Ocean: ATLAS Buoys
147/08	T	6321		Lyttelton Hr.: Works in Progress
216/08	T	45, 48		S. Taranaki Bight: Drilling Operations
221/08	T	61, 614		Tasman Bay & Golden Bay: Spat Catching Areas
233/08	T	61, 614		Golden Bay: Spat Catching Area
237/08	T	632, 6321		Lyttelton Hr.: Buoys, Lights
243/08	P	5612		Napier Hr.: New Wharf Development
244/08	P	632, 6321		Banks Peninsula: Mussel Farms
245/08	P	614		Tasman Bay: Mussel Farm
251/08	T	522, 5225		Great Barrier Island: Beacon, Light
258/08	T	63, 64		Lyttelton Hr.: Works in Progress
259/08	T	5225		Great Barrier Island: Marine Farm
262/08	T	2411		Snares Islands/Tini Heke: Seabed Obstruction
24/09	P	5215		Whangarei Hr.: Lights, Beacons
39/09	T	4314, 4315		Manukau Hr.: Light Beacons, Buoys
45/09	T	5214		Marsden Point: Works in Progress
48/09	T	6321		Sumner Head: Buoy
59/09	T	5332, 5321		Whangaparaoa: Scientific Instruments
61/09	T	43, 48, 443		North Taranaki Bight: Underwater Operations
78/09	T	43, 443		North Taranaki Bight: Waverider Buoy
79/09	T	21, 23, 42, 43	640, 641	Tasman Sea: Seismic Survey
80/09	T	21, 23, 43, 4424	640, 641	Taharoa Offshore Terminal: Buoy, Light
95/09	T	521		Bream Bay: Scientific Moorings
96/09	T	532, 5321, 5322		Hauraki Gulf: Works in Progress
97/09	T	4314		Manukau Hr.: Depths
103/09	T			Maritime Safety Broadcasts
105/09	T	23, 25, 62, 63		Kaikoura Peninsula: Scientific Moorings
106/09	T	632, 6321		Lyttelton Hr.: Dredging Operations
107/09	P	6612		Otago Hr.: Lights
108/09	T	7142		Greymouth Hr.: Depths
109/09	T	614		Tasman Bay: Current Meter

NZ 99/09 NEW ZEALAND PUBLICATIONS – New Edition to be published shortly.

NEW ZEALAND NAUTICAL ALMANAC 2009/2010 (NZ 204)

1. Mariners are advised that the 2009/2010 edition of the New Zealand Nautical Almanac (NZ 204) will be available from chart retailers early June 2009.
2. This edition covers the period 1 July 2009 to 30 June 2010 and contains updated tidal predictions for 2009/10, Annual Notices to Mariners and the New Zealand Light List.

Land Information New Zealand
NI 88/2009

NZ 100/09 NEW ZEALAND PUBLICATIONS – Raster Navigational Charts.

LINZ Raster Navigational Charts

From 1 May 2009, the *NZMariner* April 2009 Update file will be available from the LINZ website www.linz.govt.nz/hydro/nzmariner.

NZMariner Raster Navigational Charts (RNC) can only be used in conjunction with compatible viewing software called Electronic Charting Systems (ECS).

For compliance with New Zealand legal requirements for nautical charts and publications please refer to Maritime Rules Part 25, as supported by Maritime New Zealand Marine Guidance Notice 8 "Use of Electronic Charts, ECDIS and ENC's in NZ" available from the Maritime New Zealand website www.maritimenz.govt.nz.

Paper copies of Official New Zealand Charts can be purchased from LINZ chart retailers.

Further details can be found in the New Zealand Nautical Almanac (NZ204), Annual New Zealand Notices to Mariners, No.1 and on the LINZ website www.linz.govt.nz.

Land Information New Zealand
NI 92/2009

NZ 101/09 NEW ZEALAND PUBLICATIONS – New Publications to be Published Shortly.

(1) New Charts to be published shortly.

<i>Chart No.</i>	<i>Title</i>
NZ 5113	Plans in Rangaunu Bay
NZ 6144	Abel Tasman, Port Golden Bay (Tarakohe)
NZ 6324	Akaroa Harbour, French Bay

(2) New Edition to be published shortly.

<i>Chart No.</i>	<i>Title</i>
NZ 614	Tasman Bay
NZ 845	Niue, Alofi Anchorage, Alofi Landing
NZ 885	Tokelau, Atafu, Nukunono, Fakaofo
NZ 5215	Whangarei Harbour
NZ 6422	Approaches to Timaru, Timaru Harbour

Land Information New Zealand
NI 91/2009

NZ 102/09 SOUTH PACIFIC OCEAN – Tonga – Nuku'alofa Harbour – Wreck.

Chart NZ 8275 (T 8275) [139/07]

Substitute  Wk for  Wk


21° 07'.21S., 175° 11'.86W.

Chart NZ 8275 (T 8275) (plan, Nuku'alofa Wharves) [139/07]


Substitute  Wk for  Wk

21° 07'.21S 175° 11'.86W.

Land Information New Zealand
 NI 90/2009

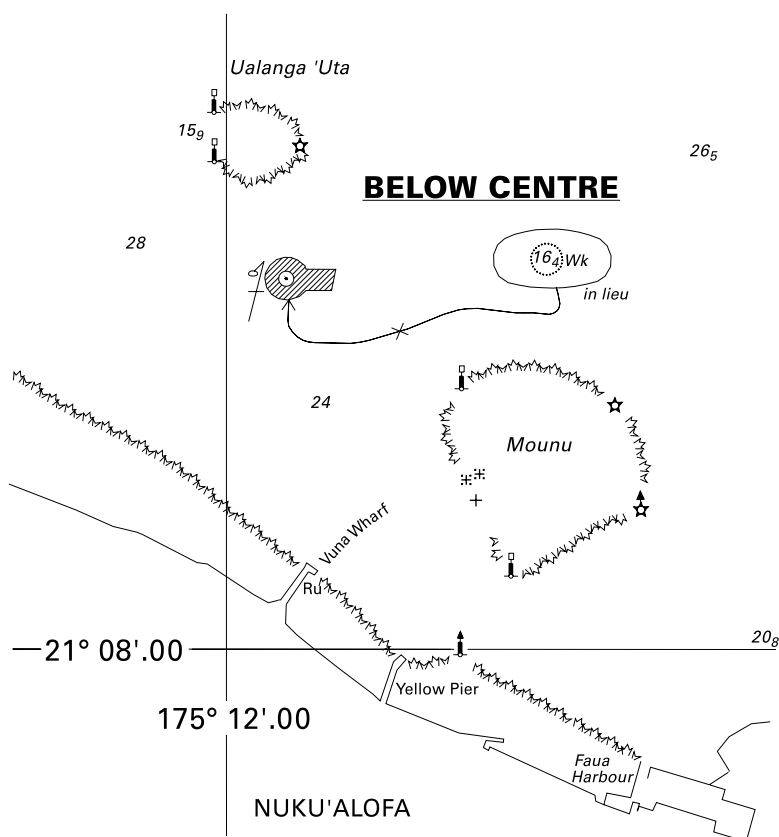

<i>Issued as a guide to chart correction.</i>		<i>Use in conjunction with the appropriate NZ Notice to Mariners.</i>
LAST CORRECTION	NZ NTM No.	CHART No.
NZ 139/07	NZ 102/09	NZ 8275 (T 8275)

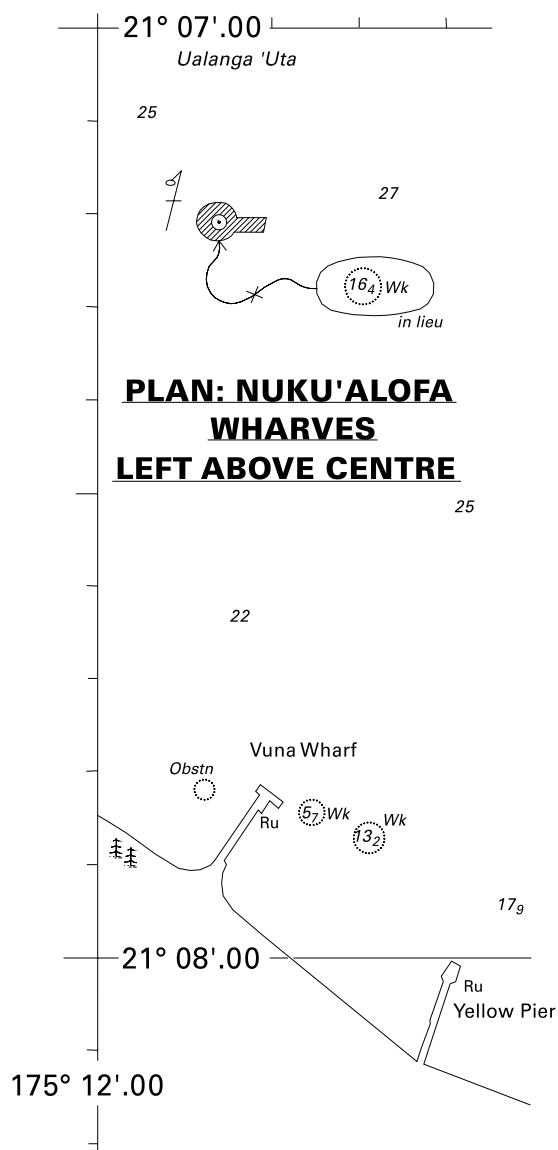

<i>Issued as a guide to chart correction.</i>		<i>Use in conjunction with the appropriate NZ Notice to Mariners.</i>
LAST CORRECTION	NZ NTM No.	CHART No.
NZ 139/07	NZ 102/09	NZ 8275 (T 8275)

NZ 103(T)/09 SOUTH WEST PACIFIC – Maritime Safety Broadcasts.

Former Notice – NZ 33(T)/09 is cancelled

Optimum R/T frequencies within Navarea XIV

The accompanying diagrams show the optimum R/T calling and working frequency bands and times for navigational warnings broadcast within 1000 nautical miles of Taupo Maritime Radio (ZLM) (38° 50'S., 176° 00'E. approx.) for the period May to July 2009.

Australian Government IPS Radio and Space Services
NI 93/2009

NZ 104(T)/09 NEW ZEALAND – North Island – East Coast – Napier Harbour – Light.

Former notice – NZ 60(T)/09 is cancelled.

Cancel this notice on receipt.

Chart formerly affected – NZ 5612

Hawke's Bay Regional Council
NZ Light List K3983.15
NI 89/2009

NZ 105(T)/09 NEW ZEALAND – South Island – East Coast – Kaikoura Peninsula – Scientific Moorings.

1. Six subsurface scientific moorings have been deployed until May 2010 at the following locations with scientific instruments suspended above the seabed:
 - a. 42° 41'.4S., 173° 52'.7E.
 - b. 42° 25'.6S., 174° 38'.4E.
 - c. 42° 32'.1S., 174° 16'.1E.
 - d. 42° 35'.1S., 174° 09'.0E.
 - e. 42° 25'.8S., 174° 16'.6E.
 - f. 42° 35'.0S., 174° 24'.1E.
2. Mariners engaged in fishing activities are requested to remain 1NM clear of the above locations.

Charts temporarily affected – NZ 23 – NZ 25 – NZ 62 – NZ 63

NIWA
NI 86/2009

NZ 106(T)/09 NEW ZEALAND – South Island – East Coast – Lyttelton Harbour – Dredging Operations.

1. The dredger *Pelican* will undertake dredging operations in the Lyttelton Harbour main navigation channel until June 2009. The dredger is restricted in its ability to manoeuvre.
2. All vessels are advised to keep clear of operations and to give the dredger a wide berth.
3. The dredger will maintain a listening watch on VHF Channel 12.

Chart temporarily affected – NZ 632– NZ 6321

Lyttelton Port of Christchurch
NI 98/2009

NZ 107(P)/09 NEW ZEALAND – South Island – East Coast – Otago Harbour – Lights.

1. The characteristics of the following 8 lights have been changed as listed below:

Position	Type	Light	Name
Lower Harbour			
45° 46'.82S., 170° 43'.14E.	Starboard Beacon	Fl(2)G.5s	No.1A
45° 47'.16S., 170° 43'.12E.	Starboard Beacon	Oc.G.4s	Spit Tide Gauge Pile
45° 47'.48S., 170° 40'.81E.	Starboard Beacon	Fl(2)G.5s	No.13
45° 47'.63S., 170° 40'.75E.	Port Beacon	Fl(2)R.5s	No.14
45° 47'.99S., 170° 39'.04E.	Port Beacon	Oc.R.4s	No.18A
45° 47'.90S., 170° 38'.47E.	Starboard Beacon	Fl(3)G.6s	No.19A
45° 47'.93S., 170° 38'.33E.	Starboard Beacon	Fl.G.3s	No.21
45° 48'.81S., 170° 37'.99E.	Port Beacon	Fl(2)R.5s	No.28

2. Charting action will be taken in due course.

Chart affected – NZ 6612

Port Otago Ltd

NZ Light List K4367, K4367.12, K4368.4, K4368.5, K4368.95, 4369.1, K4369.5, K4370.3

NI 97/2008

NZ 108(T)/09 NEW ZEALAND – South Island – West Coast – Greymouth Harbour Entrance – Depths.

Former notice – NZ 88(T)/09 is cancelled.

1. A recent survey (22 April 2009) indicates the following depths below CD on the bar at the Grey River entrance:

North Transit Lead	2.4m	42° 26'.33S., 171° 11'.40E.
Central Transit Lead	2.4m	42° 26'.36S., 171° 11'.42E.
South Transit Lead	2.4m	42° 26'.37S., 171° 11'.41E.

2. Mariners should be aware that depths in Greymouth Harbour are constantly changing and should contact the Harbourmaster for the latest conditions on (027) 435 3424 or (03) 768 5666 or Greymouth Harbour Radio Ch14.

Charts temporarily affected – NZ 7142

Port of Greymouth
NI 95/2009

NZ 109(T)/09 NEW ZEALAND – South Island – North Coast – Tasman Bay – Current Meter.

1. A current meter marked by a yellow buoy, Q(5)Y.20s has been laid in position 41° 04'.34S., 173° 03'.34E. until June 2009.
2. Mariners are requested to exercise caution when navigating in the area.

Charts temporarily affected – NZ 614

Cawthron Institute
NI 94/2009

III

CORRECTIONS TO NEW ZEALAND LIGHT LIST

(NZ NTM Edition No.9 dated 1 May 2009)

NEW ZEALAND NAUTICAL ALMANAC 2008/09 LIGHT LIST SECTION

3983.15	- Inner Dir Lt	39 28.43 176 55.31	Dir WRG	28	2	Tower, Floodlit	FG 094°-102° (8°) Al WG 102°-107° (5°) FW 107°-116° (9°) Al WR 116°-121° (5°) FR 121° - 129° (8°) *
3994	Castle Point (M)	40 54.02 176 13.88	Fl(3)W 30s	52	26	White metal tower 23	fl 0.2, ec 2, fl 0.3, ec 2, fl 0.2, ec 25.3. Vis 209°-029° (180°) Reserve Light range 10 M.
		*					
4367	No. 1A	45 46.82 170 43.14	Fl(2)G 5s	3	3	Green Δ on green beacon	Ra refl
		*	*				
4367.12	Spit Tide Gauge Pile	45 47.16 170 43.12	Oc G 4s	3	3	Green Δ on steel pile	
			*		*		
4368.4	No. 13	45 47.48 170 40.81	Fl(2)G 5s	3	3	Green Δ on green beacon	Ra refl
		*	*			*	
4368.5	No. 14	45 47.63 170 40.75	Fl(2)R 5s	3	3	Red □ on red beacon	Ra refl
		*	*		*		
4368.95	No. 18A	45 47.99 170 39.04	Oc R 4s	3	3	Red □ on red beacon	Ra refl
		*	*				
4369.1	No. 19A	45 47.90 170 38.47	Fl(3)G 6s	3	3	Green Δ on green pile beacon	Neon □. Ra refl
		*	*				
4369.5	No. 21	45 47.93 170 38.33	Fl G 3s	3	3	Green Δ on green pile beacon	Ra refl
		*	*		*		
4370.3	No. 28	45 48.81 170 37.99	Fl(2)R 5s	3	3	Red □ on red beacon	Ra refl
		*	*		*		

(NI 87, 89, 97/2009)

IV

CORRECTIONS TO PUBLICATIONS

(NZ NTM Edition No.9 dated 1 May 2009)

Nil

V

NAVIGATIONAL WARNINGS

Navarea XIV warnings in force 29 April 2009

NAVAREA XIV

(South West Pacific)

085/08 SOUTH PACIFIC. VOLUNTARY SHIP REPORTING SYSTEM IN THE NEW ZEALAND SEARCH AND RESCUE AREA SOUTH OF 60° SOUTH.

1. The New Zealand Search and Rescue Authorities have established a voluntary ship reporting system for all vessels operating in the NZSAR region South of 60° South for the purposes of assisting the SAR Authority in coordinating SAR operations in that area.
2. Area covered: 60°S to the southern edge of the Ross Sea bounded by 163° E. to 131°W.
3. All vessels are requested to notify Taupo Maritime Radio on entry and departure into the area and are also encouraged to make daily position reports. Information provided will be used for SAR purposes only.
4. Taupo Maritime Radio can be contacted on INMARSAT C 582 451 200 067, hf, email maritime@kordia.co.nz or 00 64 4 914 8333.

014/09 SOUTH PACIFIC. FRENCH POLYNESIA. INT CHART 607

1. 300000 UTC Mar 09, pearl farms in atolls bounded by positions 14 00S., 153 00W., 24 00S., 133 00W. may constitute a danger to navigation.
2. All information on precise position of pearl farms can be obtained from pearl center service, Tahiti, at +689 50 00 13 giving 48 hours notice. Inquire regularly before passage as pearl farms are susceptible to modification at short notice.
3. List of atolls

Mopelia - Tahaa - Raiatea - Huahine - Tikehau - Rangiroa - Ahe - Manihi - Takapoto - Takaroa - Arutua - Kaukura - Apataki - Toau - Fakarava - Faaite - Aratika - Kauehi - Raraka - Katiu - Makemo - Taenga - Raroia - Takume - Marokau - Nengonengo - Hao - Amanu - Marutea Sud - Gambier (Mangareva, Akamaru, Aukena)
4. Cancel this message 300000 UTC Apr 09


VI

CORRECTIONS TO ADMIRALTY LIST OF RADIO SIGNALS

(NZ NTM Edition No.9 dated 1 May 2009)

Nil

Recommended frequency bands for communication with Taupo MAY - JULY 2009

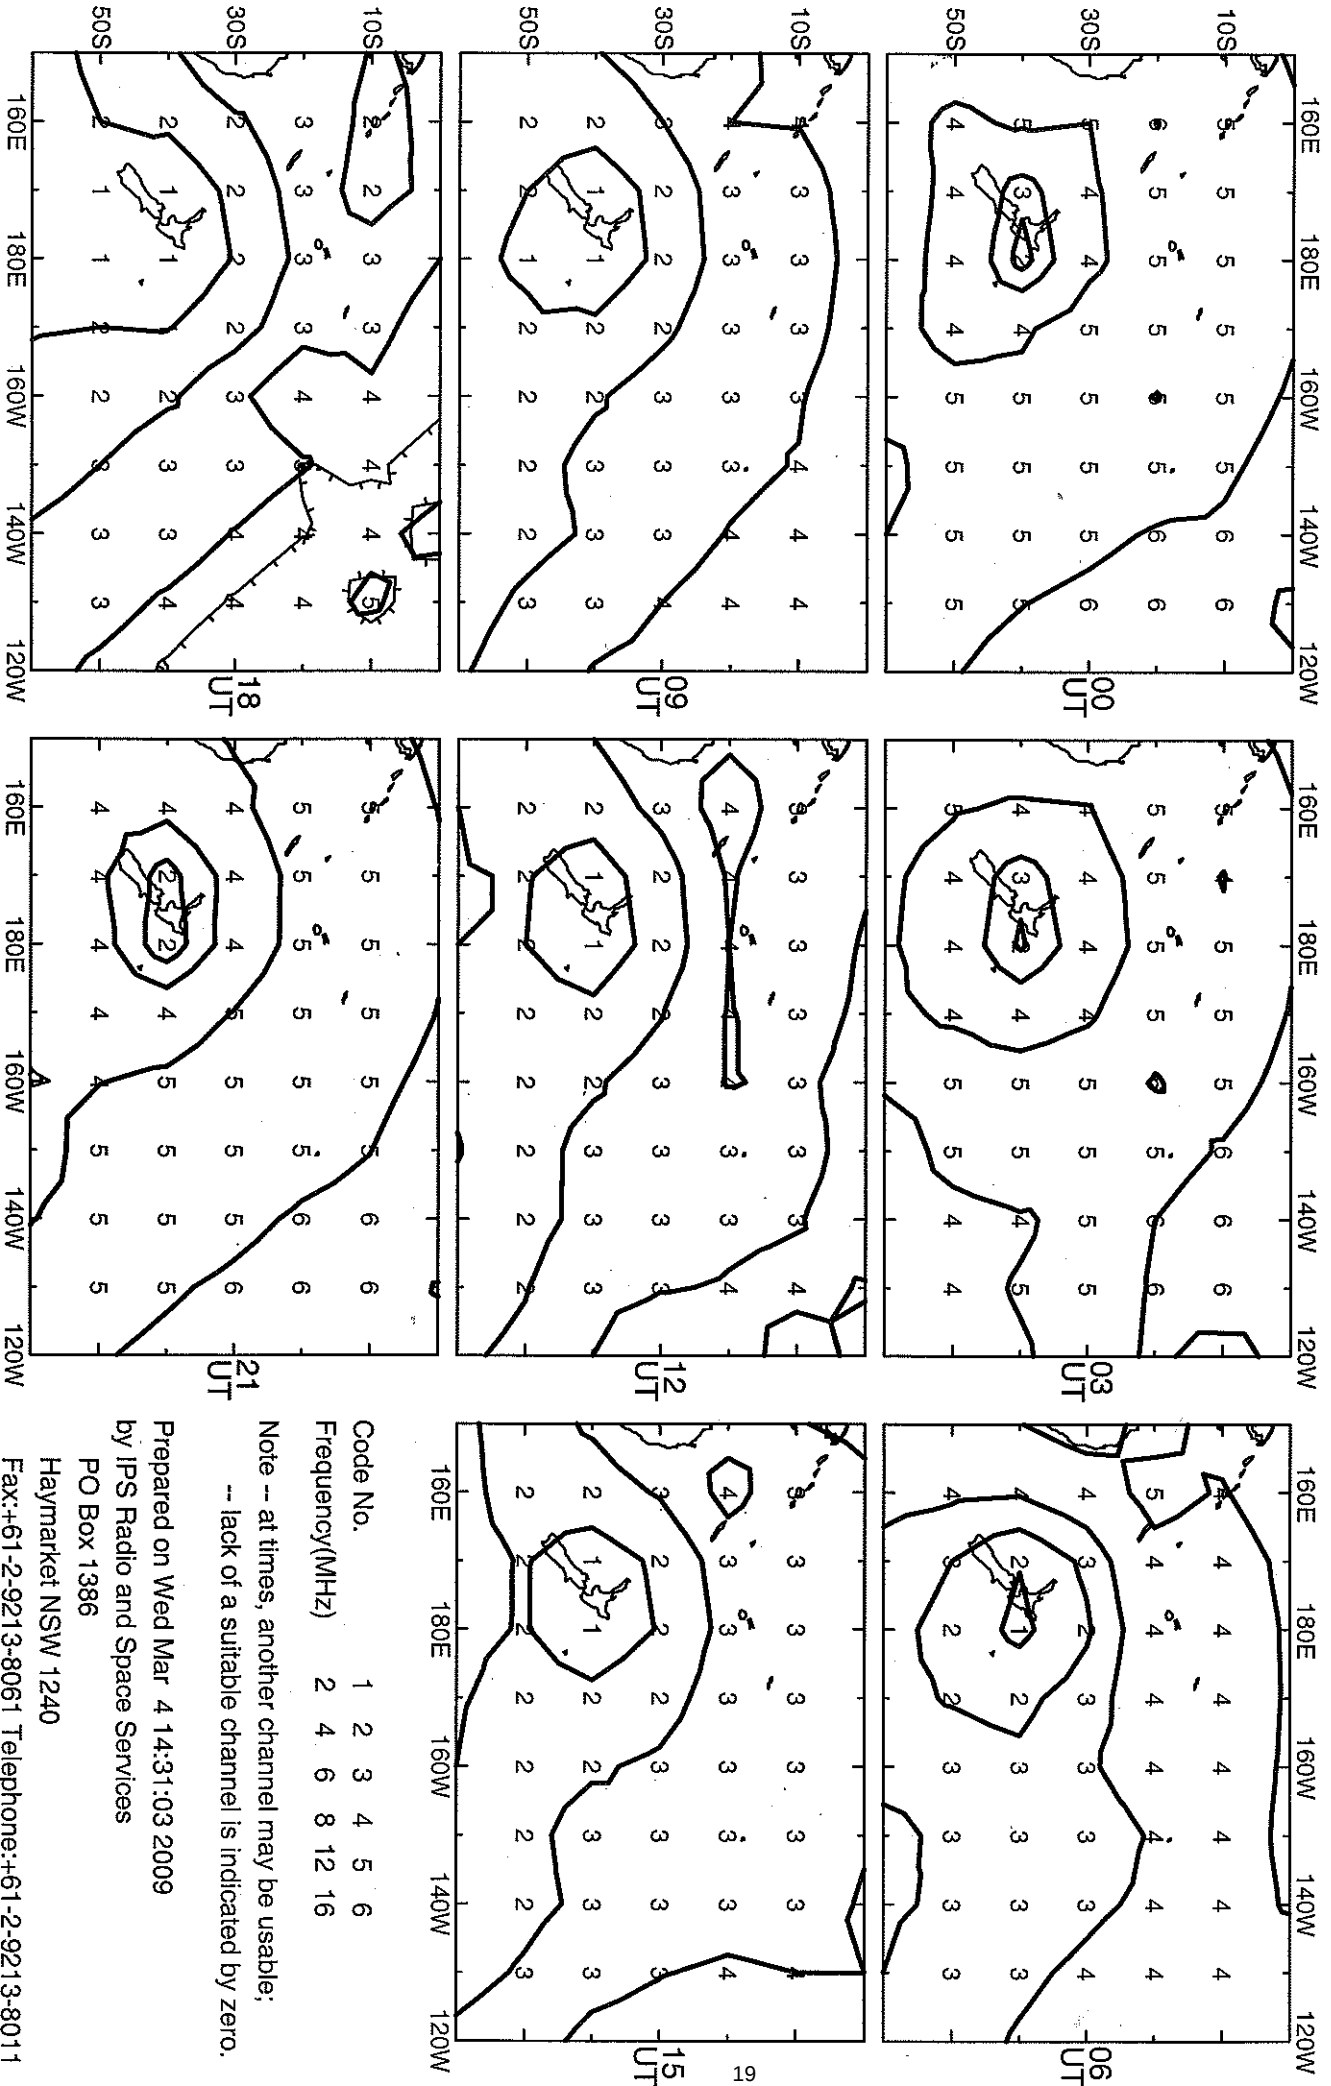

IPS Radio and Space Services
Local Area Mobile Predictions

May - July 2009

NAVAREA XIV

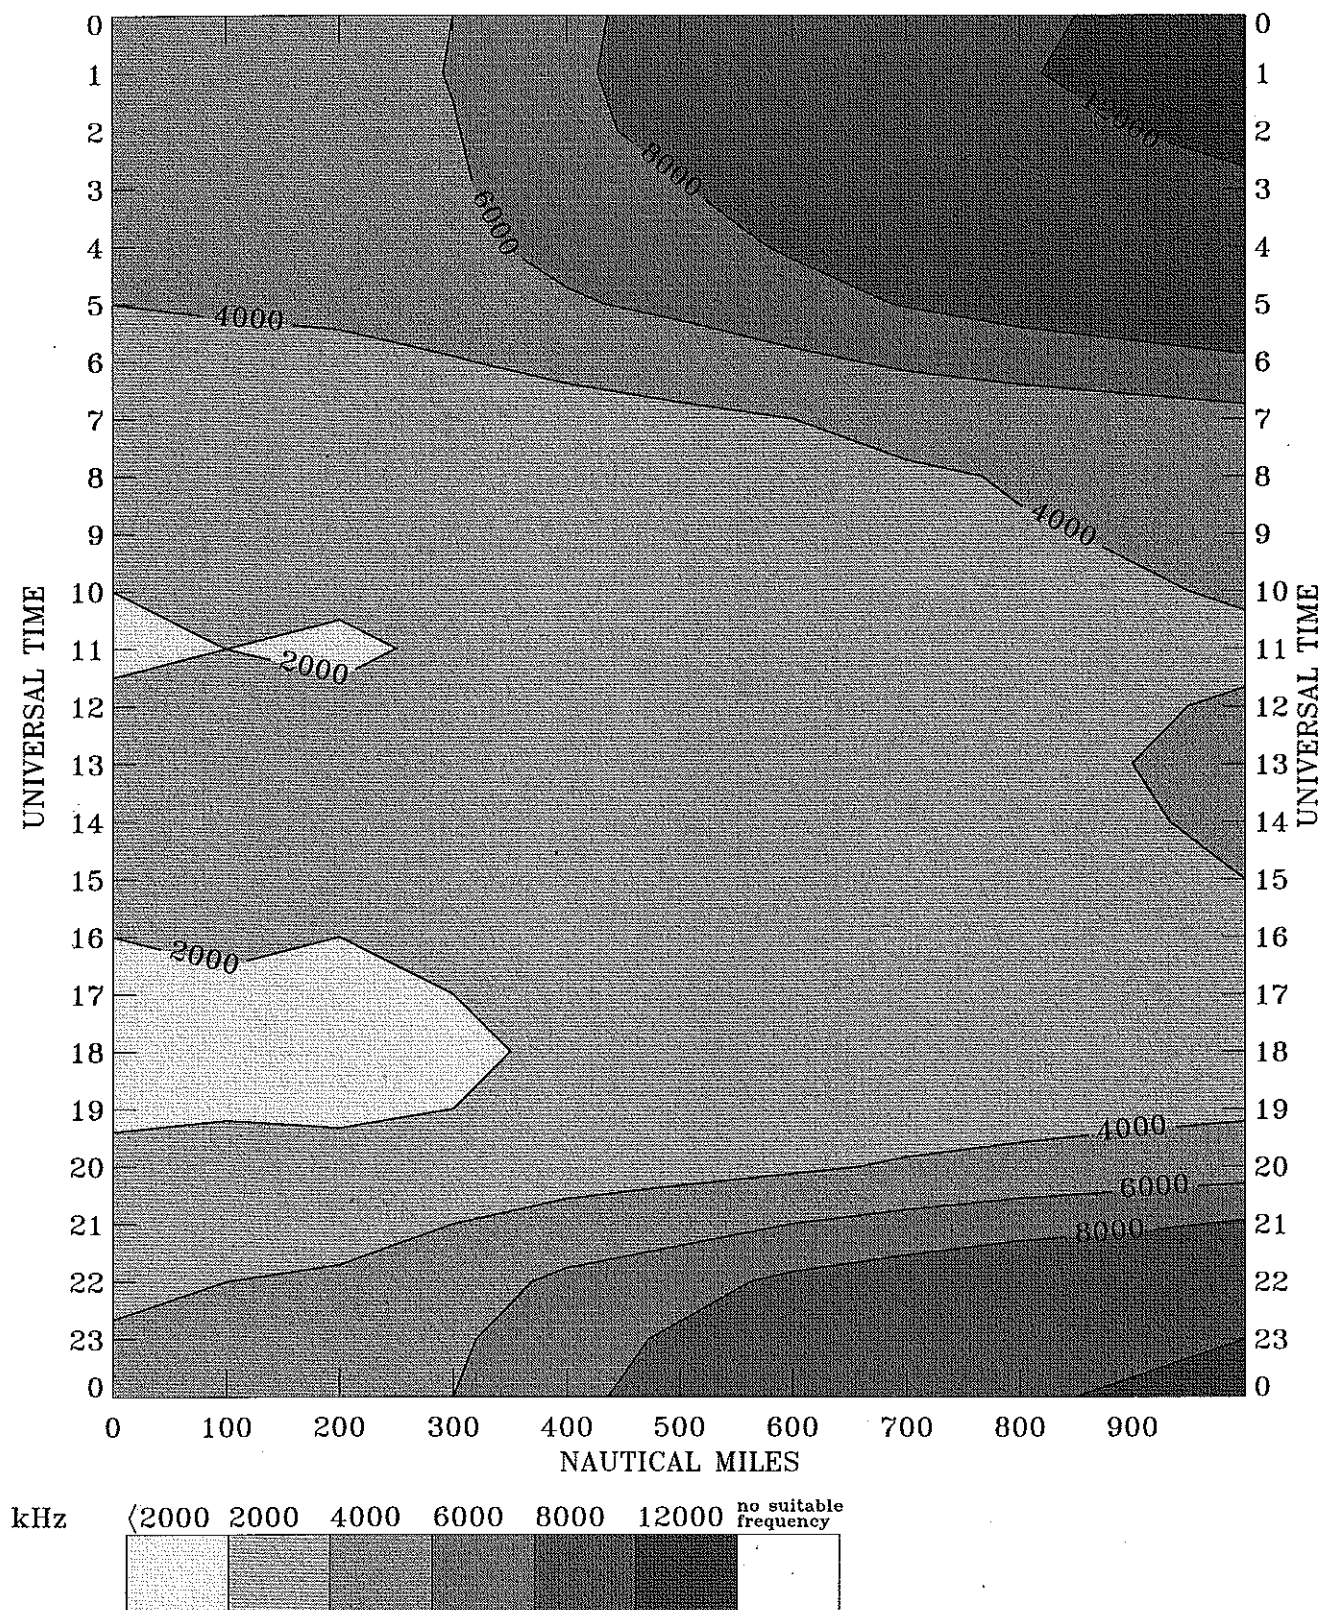


Chart: 1

Address No: 9038